

This Page Is Inserted by IFW Operations
and is not a part of the Official Record

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images may include (but are not limited to):

- BLACK BORDERS
- TEXT CUT OFF AT TOP, BOTTOM OR SIDES
- FADED TEXT
- ILLEGIBLE TEXT
- SKEWED/SLANTED IMAGES
- COLORED PHOTOS
- BLACK OR VERY BLACK AND WHITE DARK PHOTOS
- GRAY SCALE DOCUMENTS

IMAGES ARE BEST AVAILABLE COPY.

**As rescanning documents *will not* correct images,
please do not report the images to the
Image Problem Mailbox.**

09747648-122600

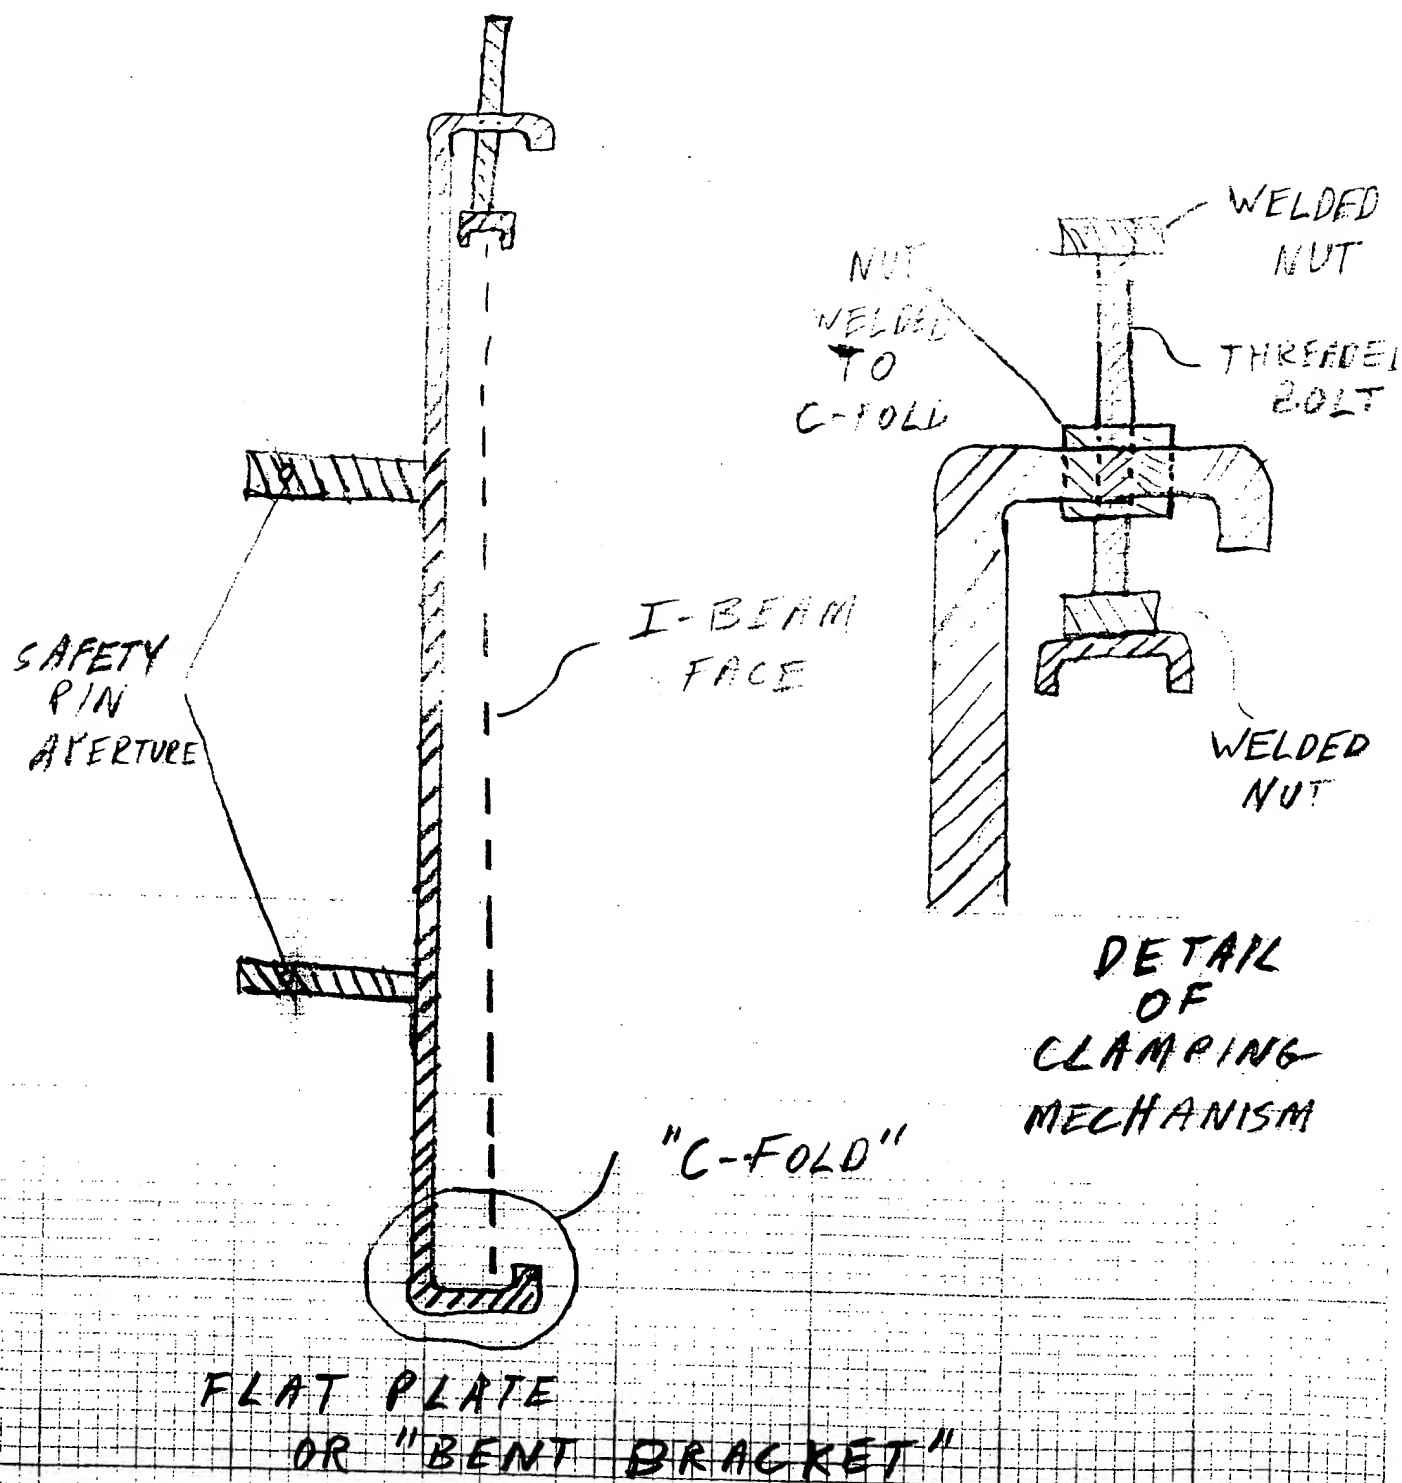


FIG. 1

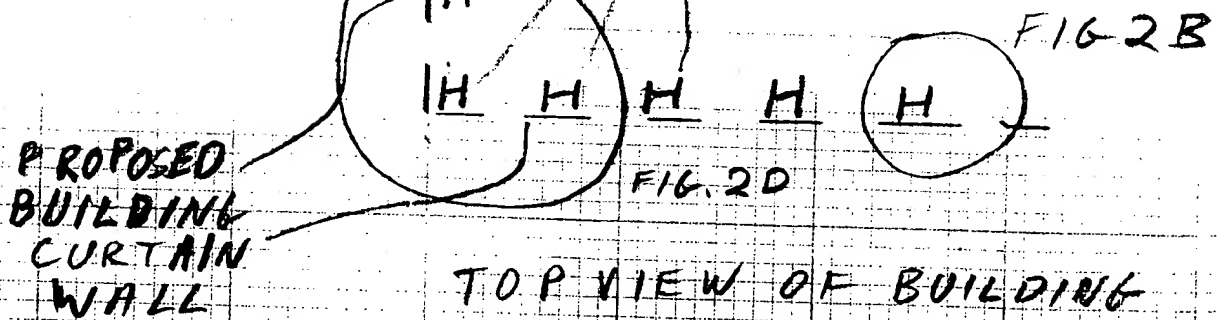
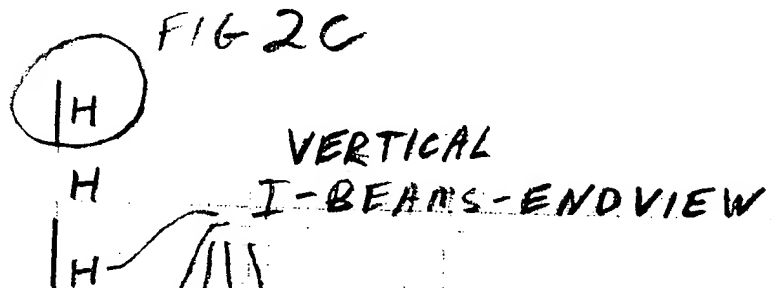
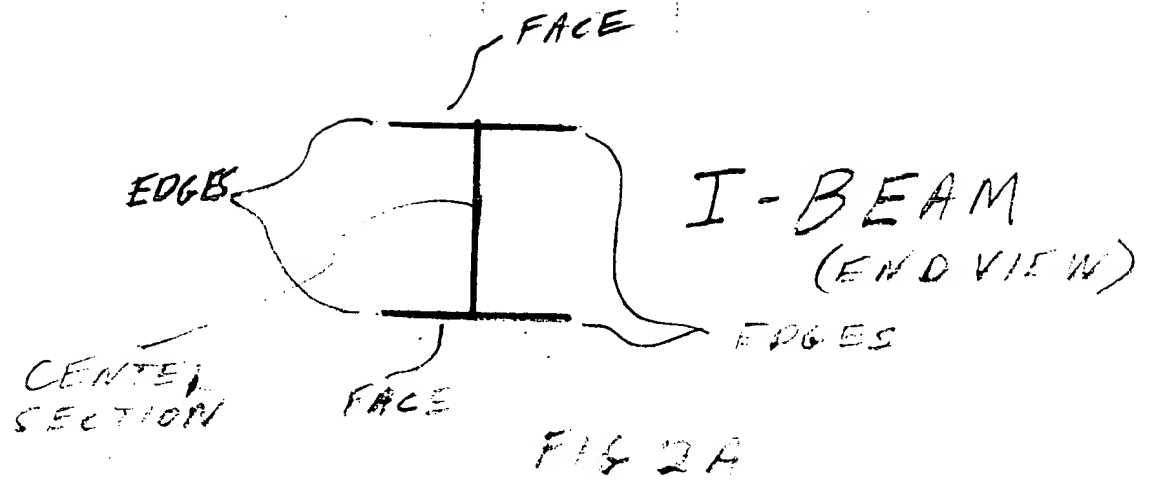


FIG 2

009227 3492460

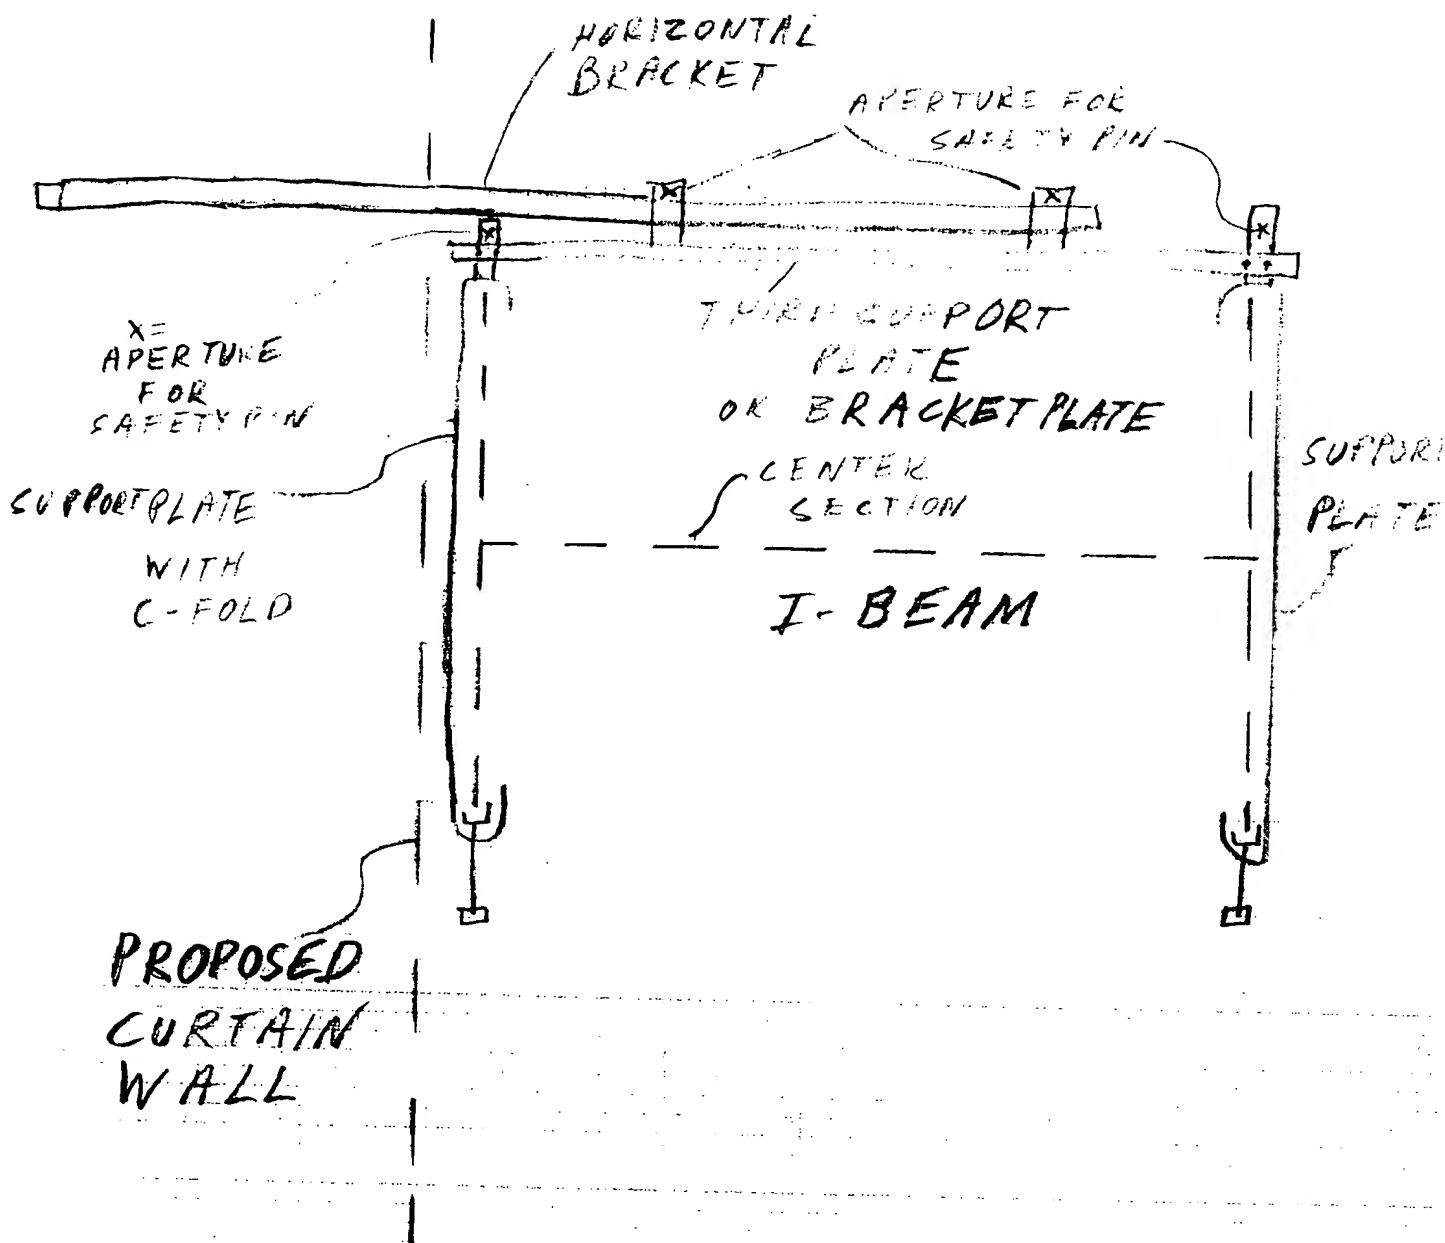


FIG 3

FIG 2C WITH INVENTION-TOPVIEW
 -VERT. I-BEAM CENTER SECTION
 PERPENDICULAR TO
 PROPOSED CURTAIN WALL-

009227 8492760



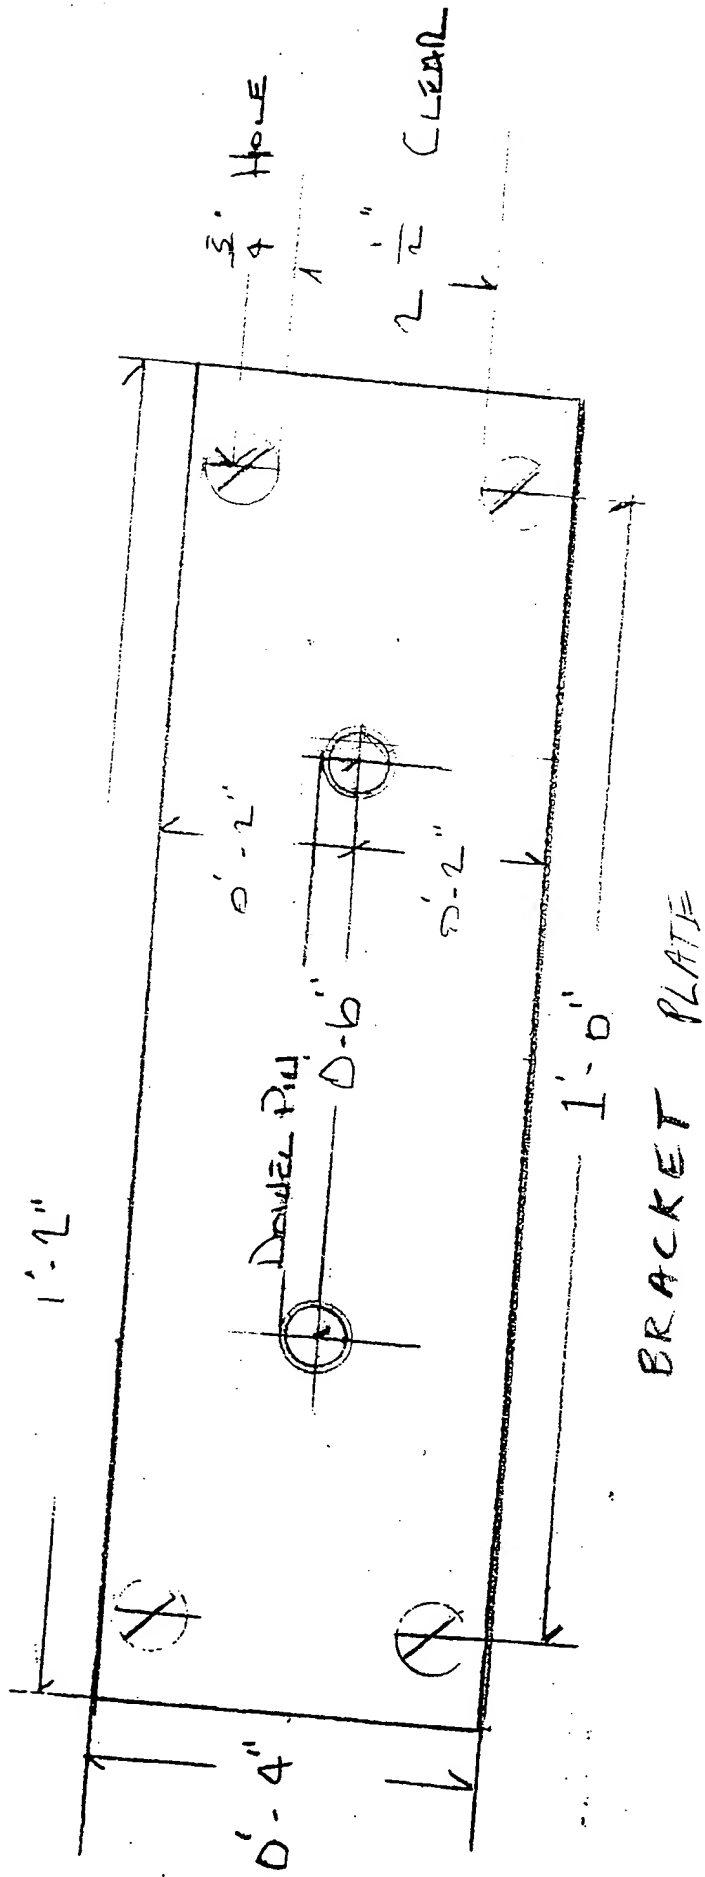



FIG 4

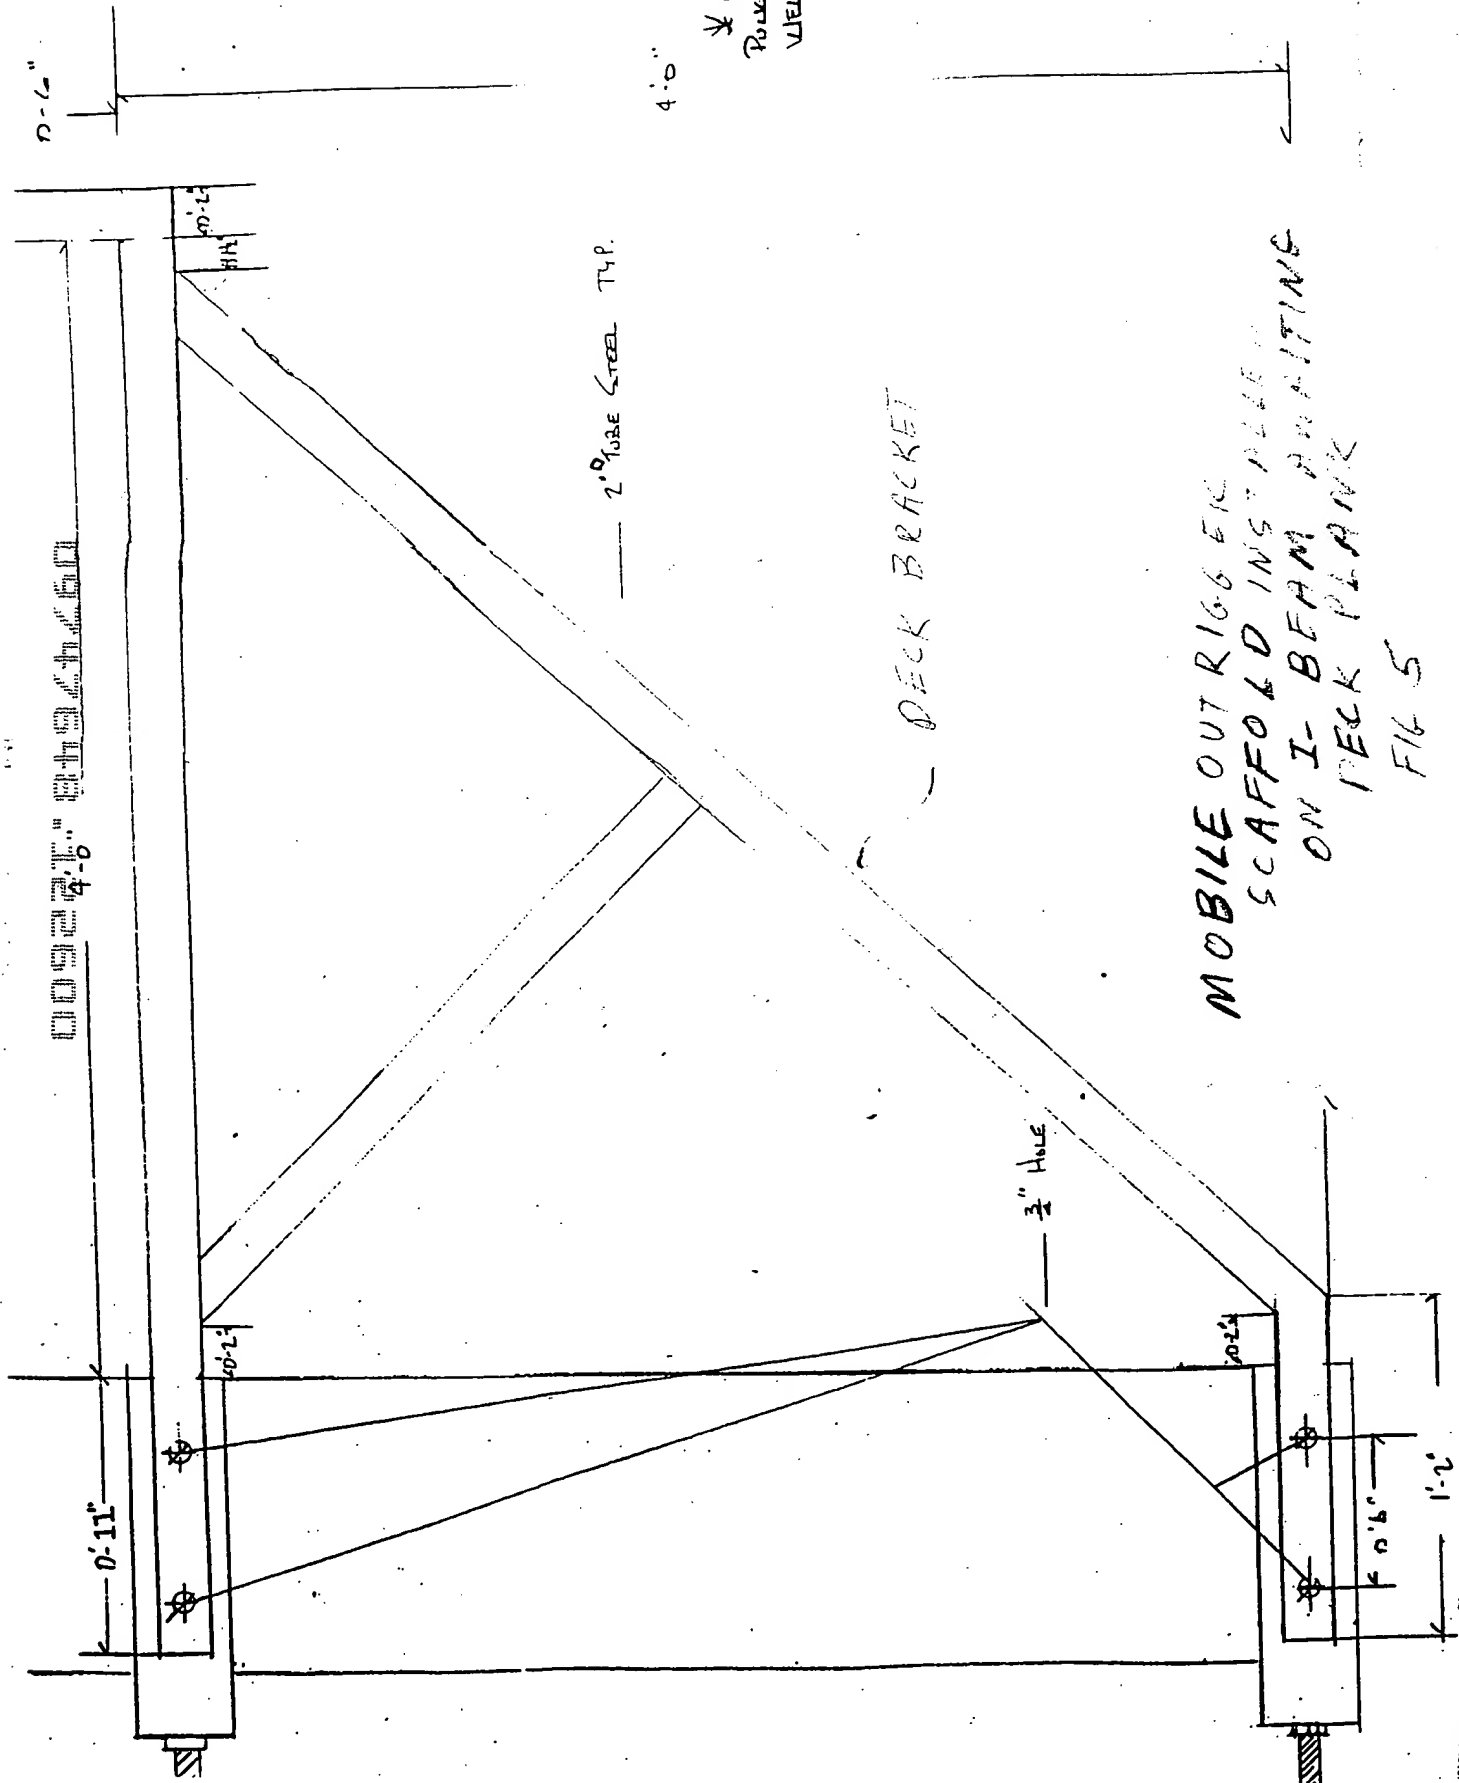

09742648-12600

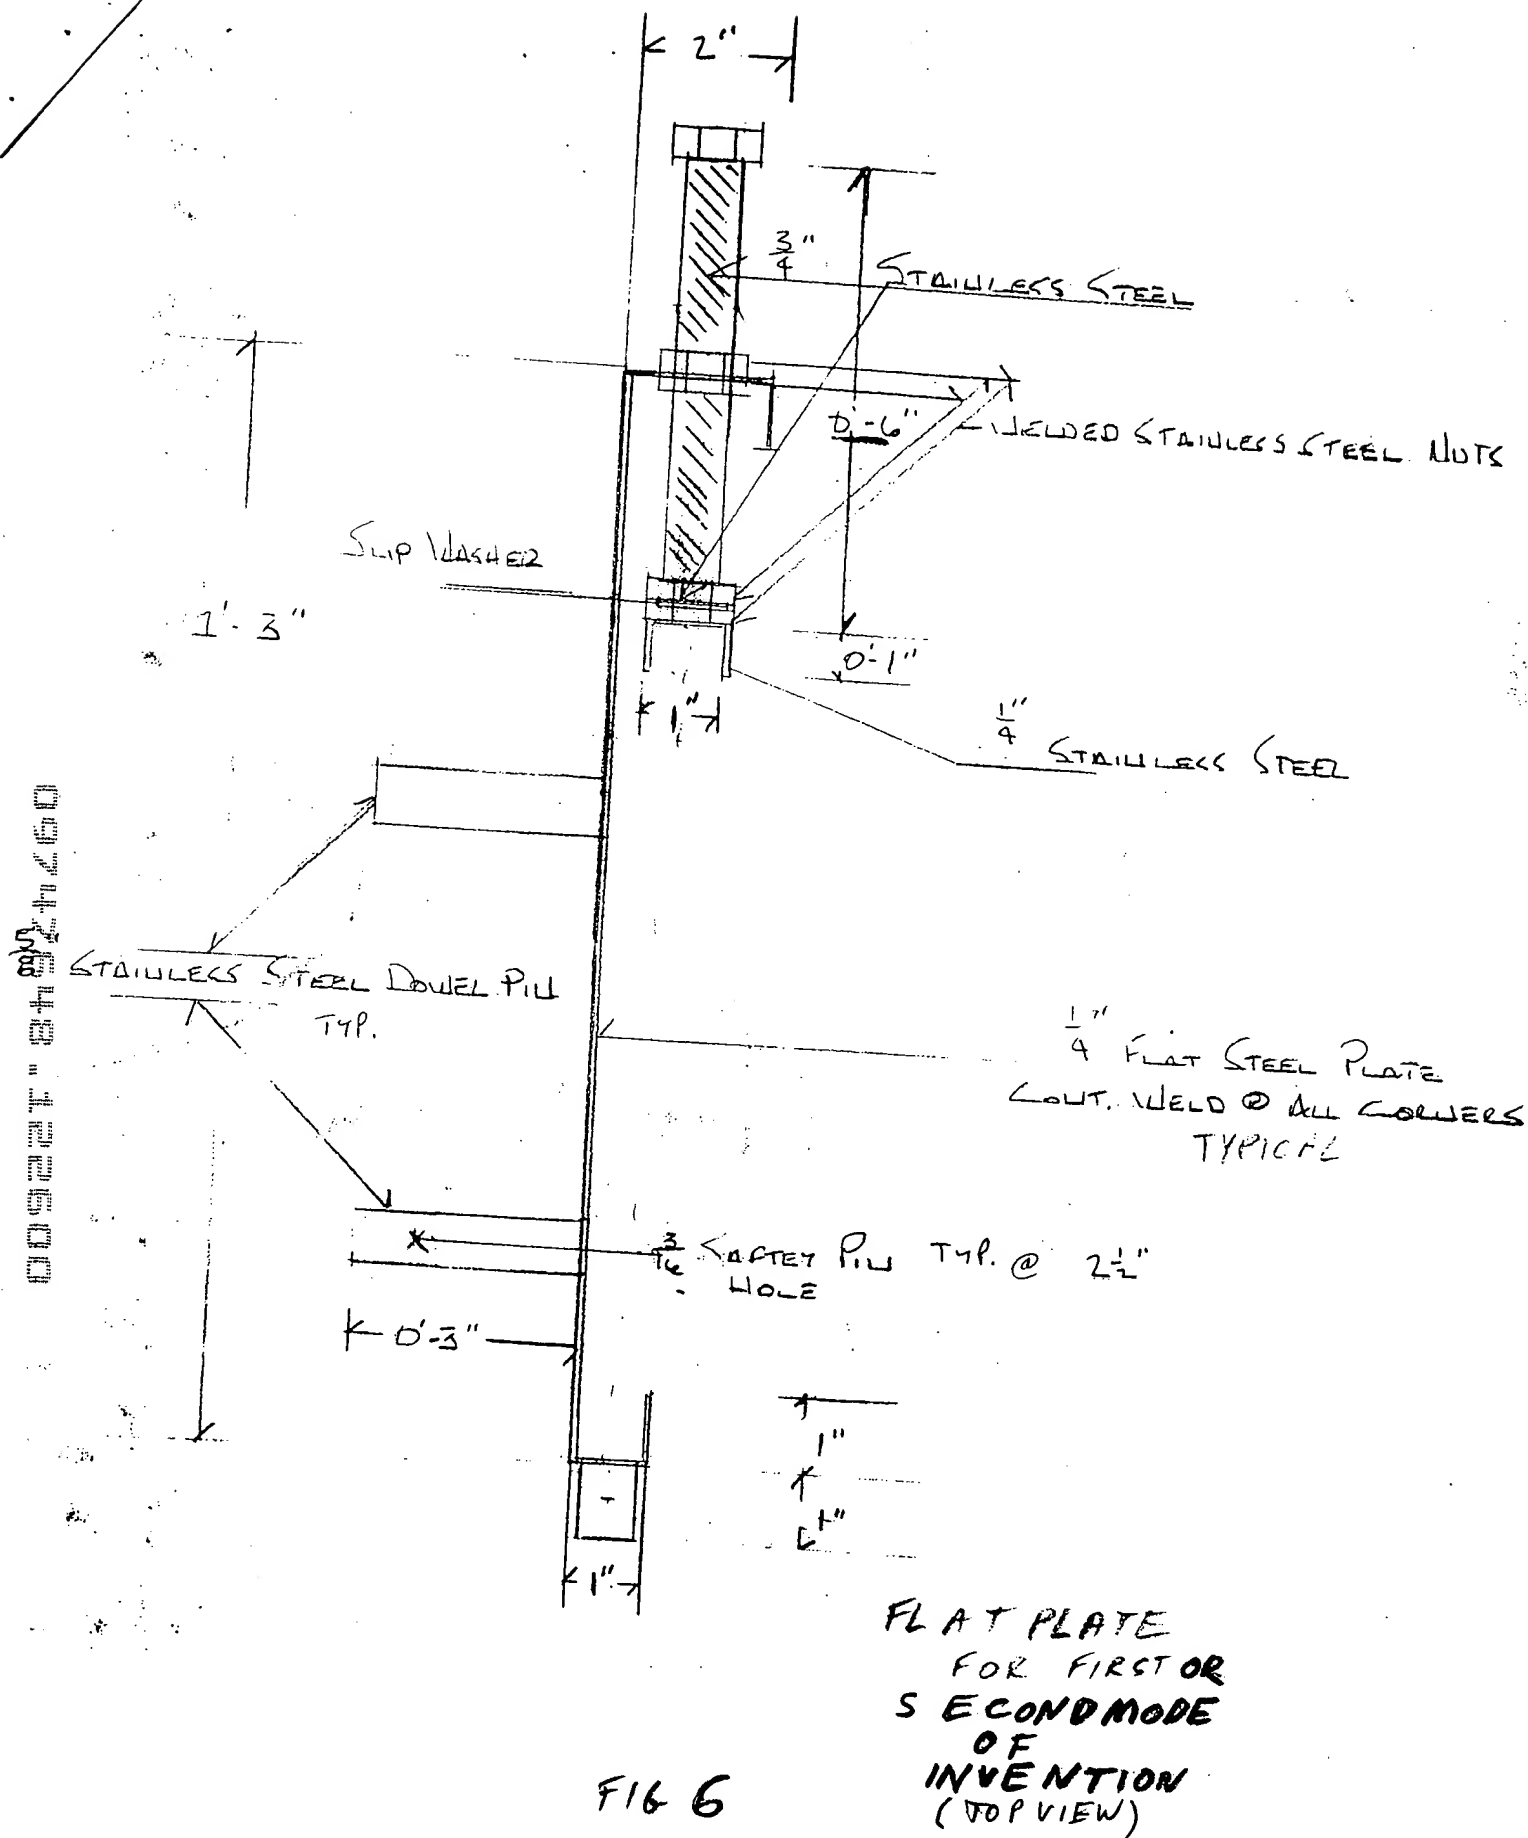

003227" 8494260

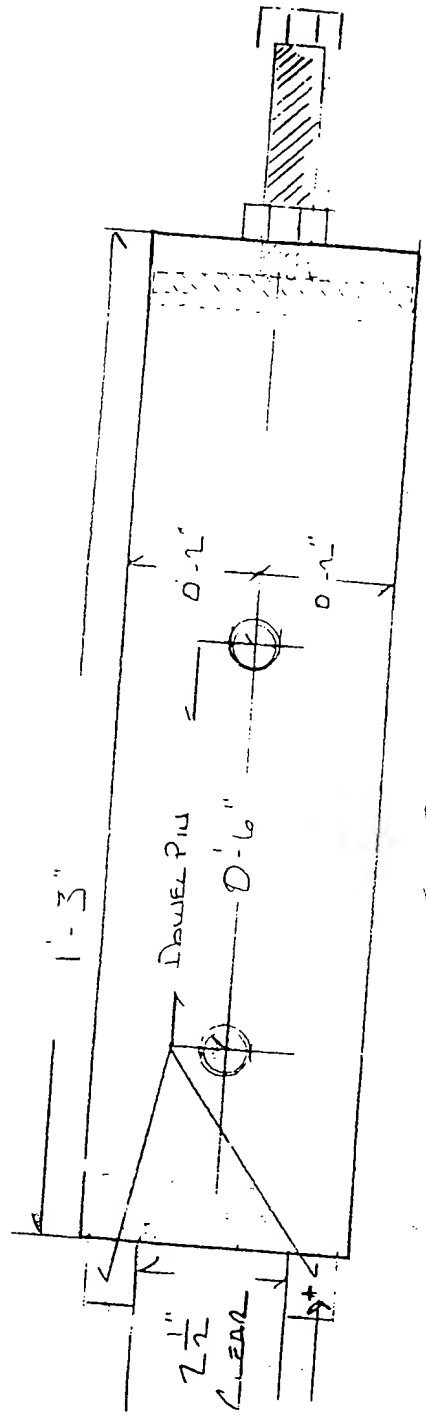

3/16 SAE 5140 1/2"
Hole Tap

Fig 7

FLAT PLATE FOR FIRST
SECOND MODE OF VIBRATION
(SIDE VIEW)

09747649-12300

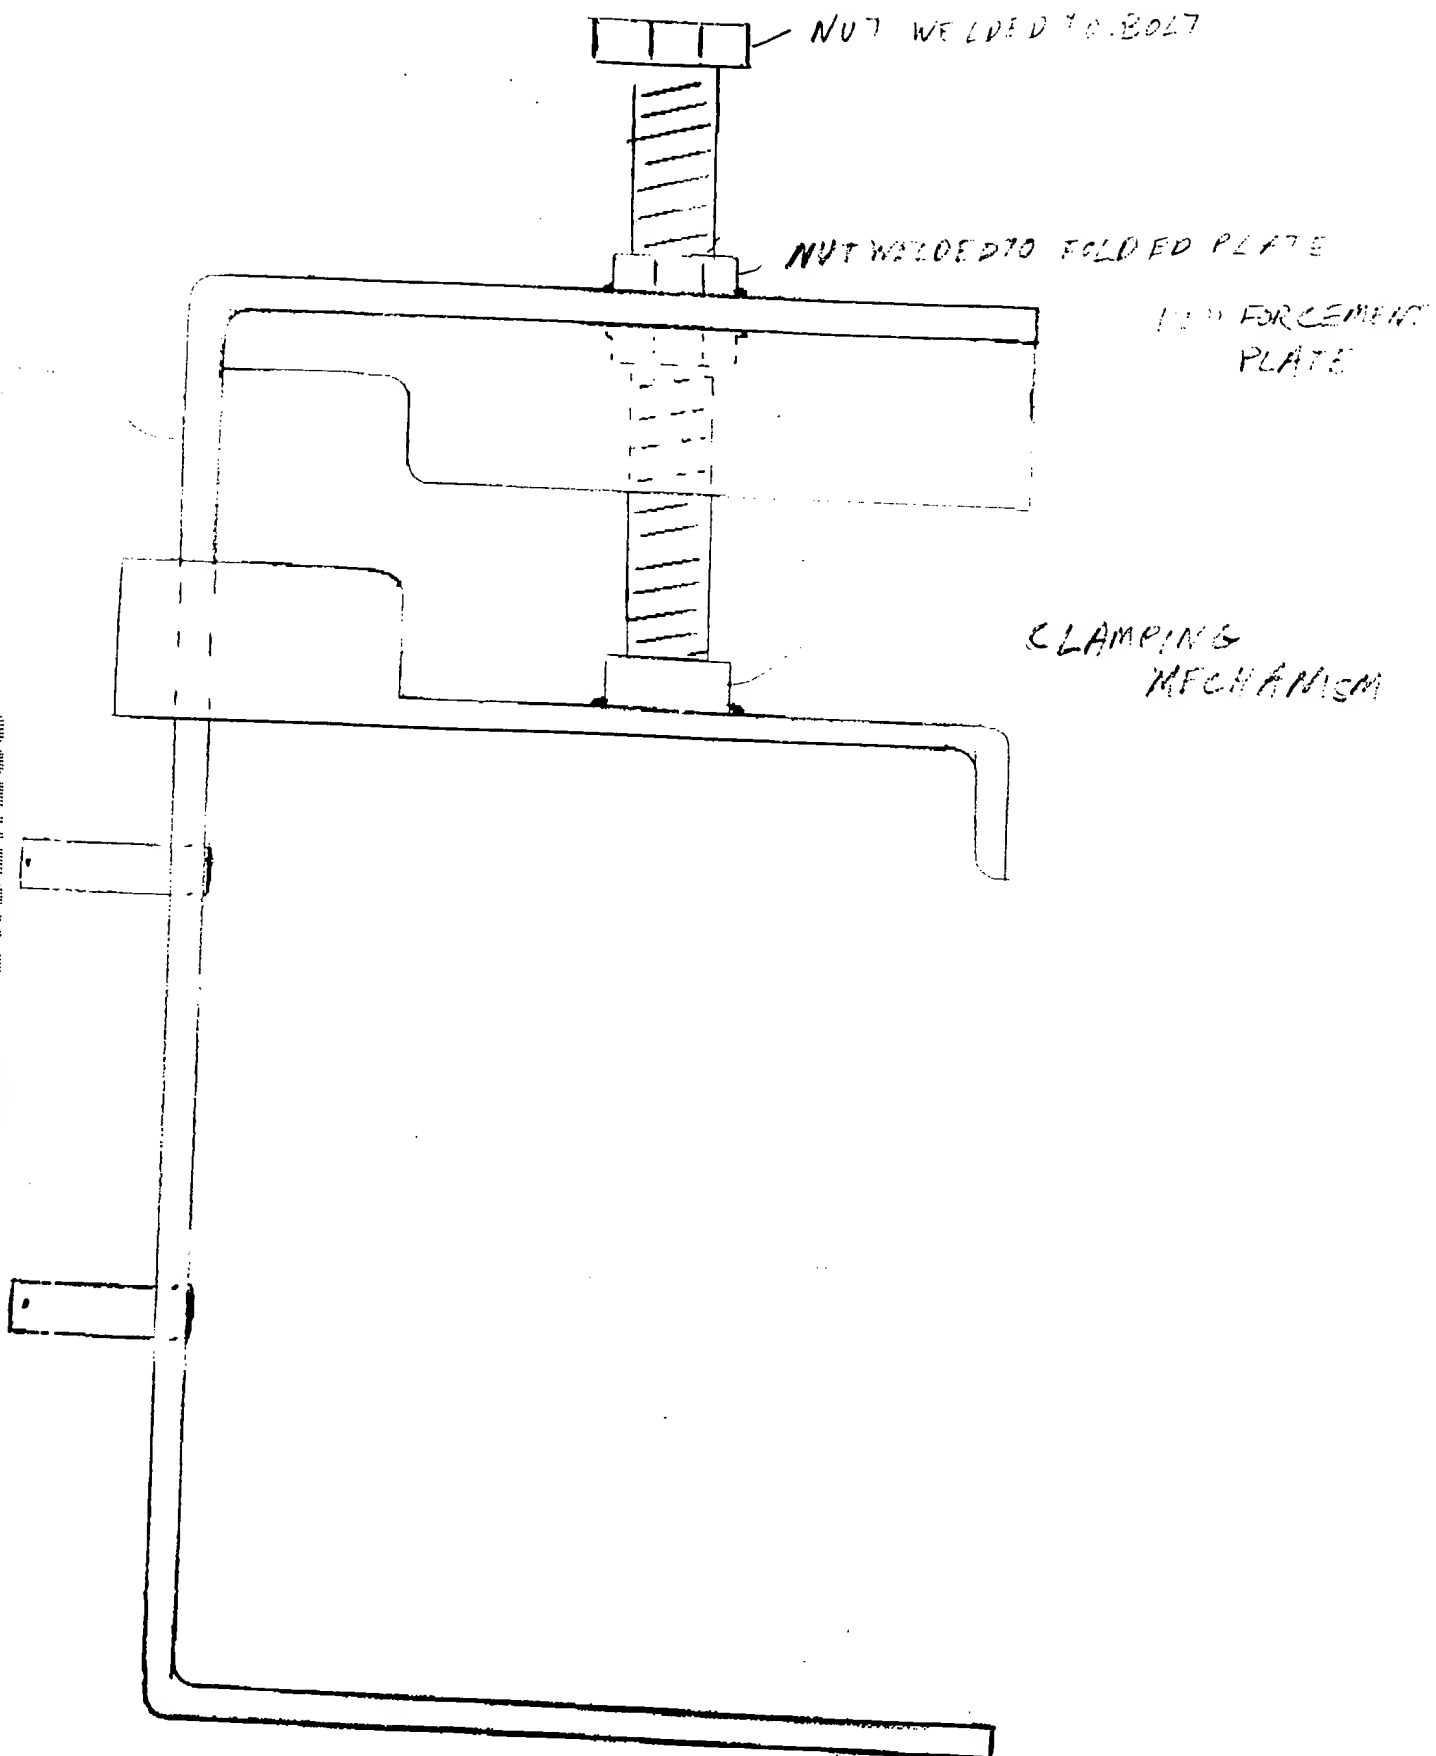


FIGURE 8
TOP VIEW - "L-FOLD"

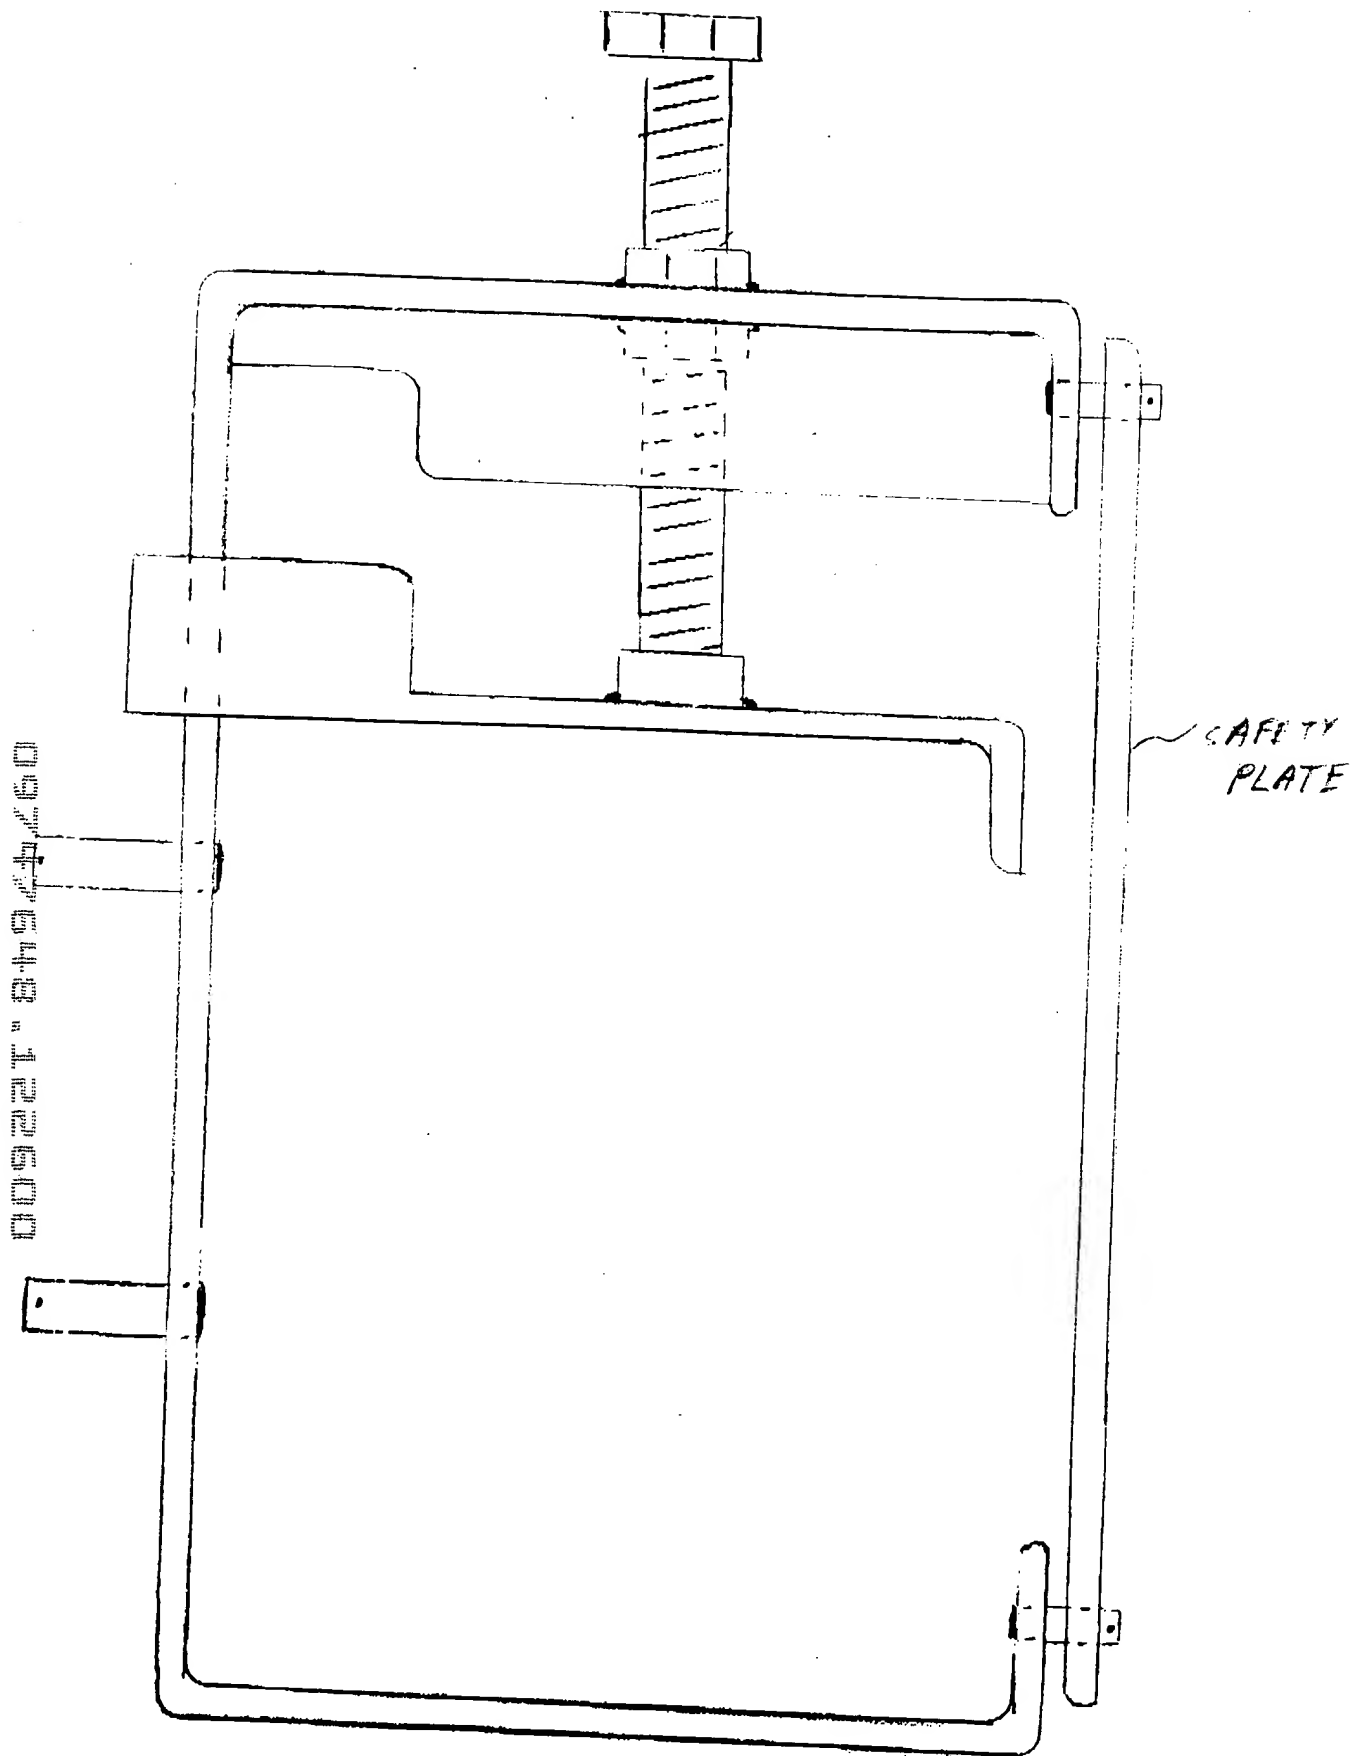


FIGURE 9
TOP VIEW "C-FOLD"

009227 848 122500

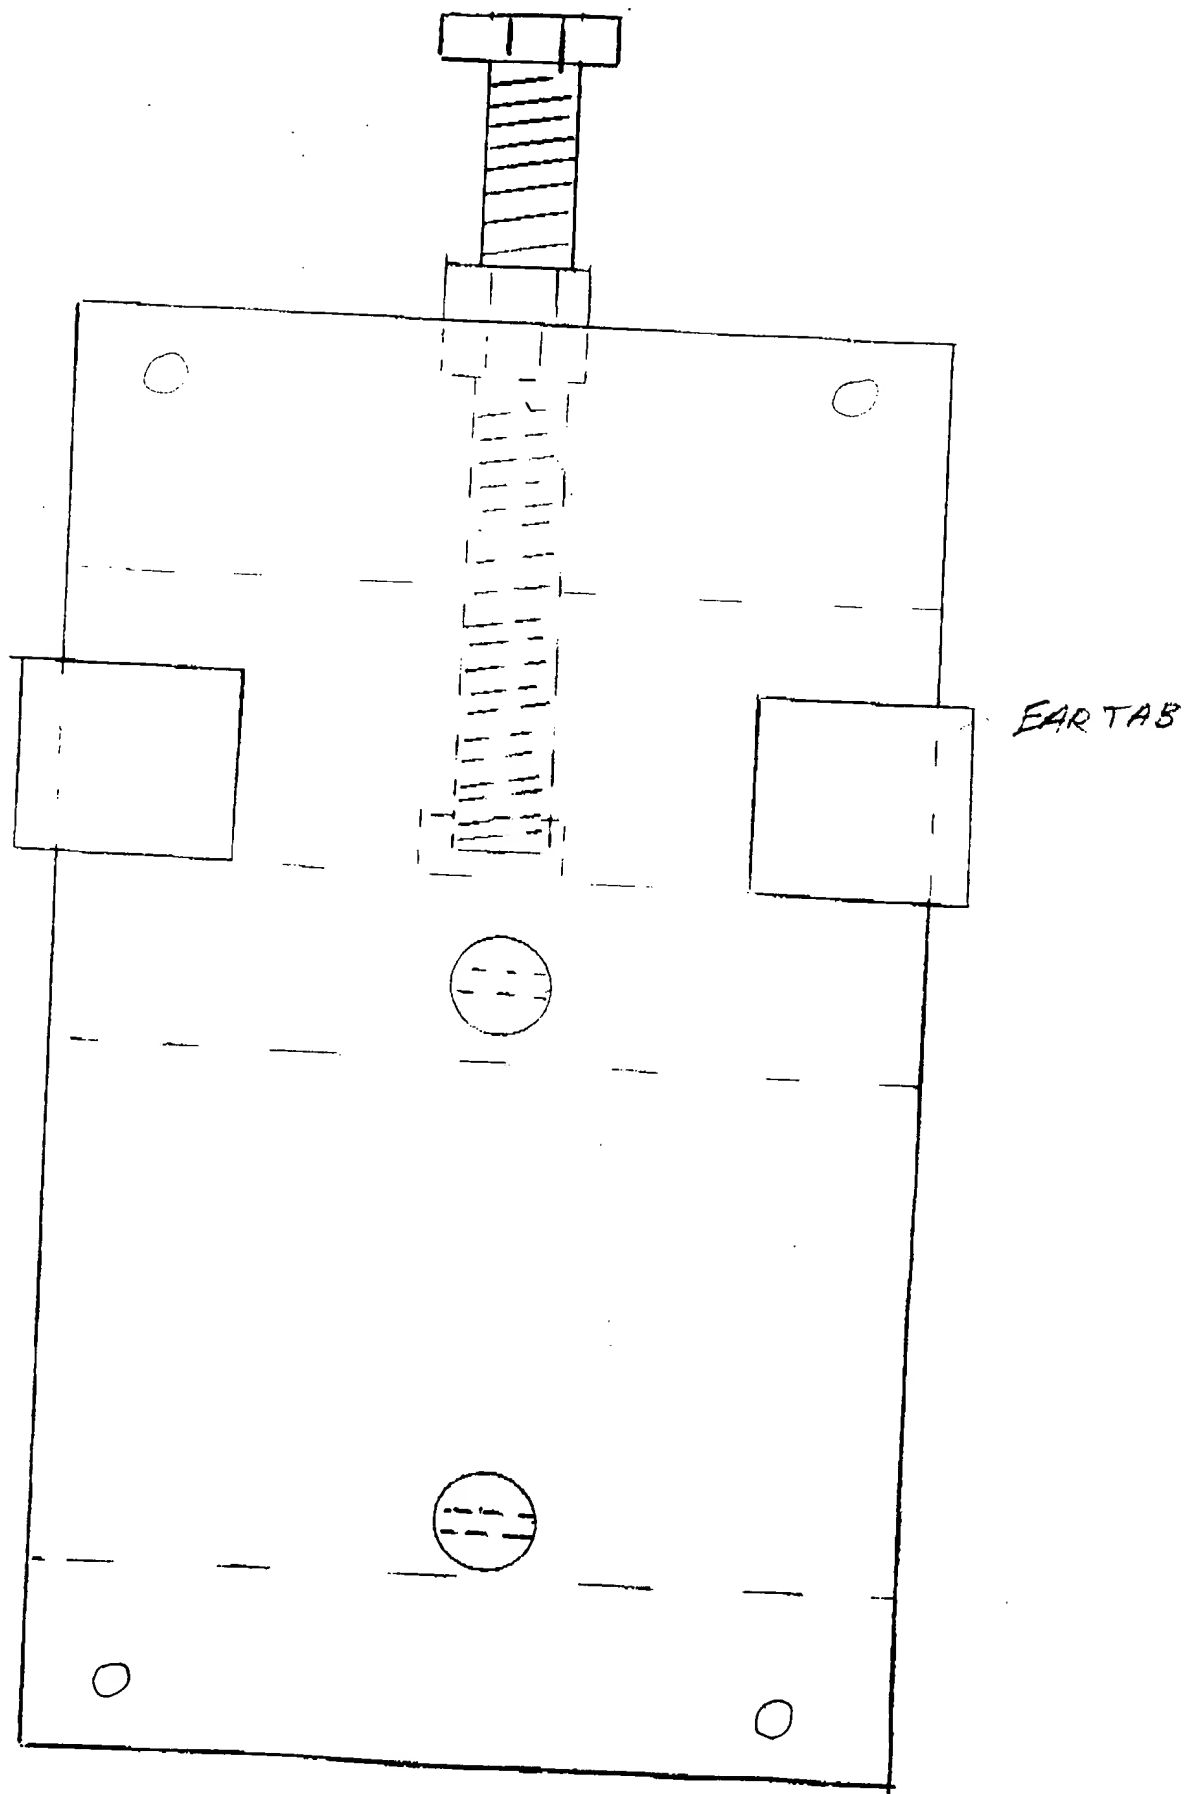


FIGURE 10A

09747648-123600

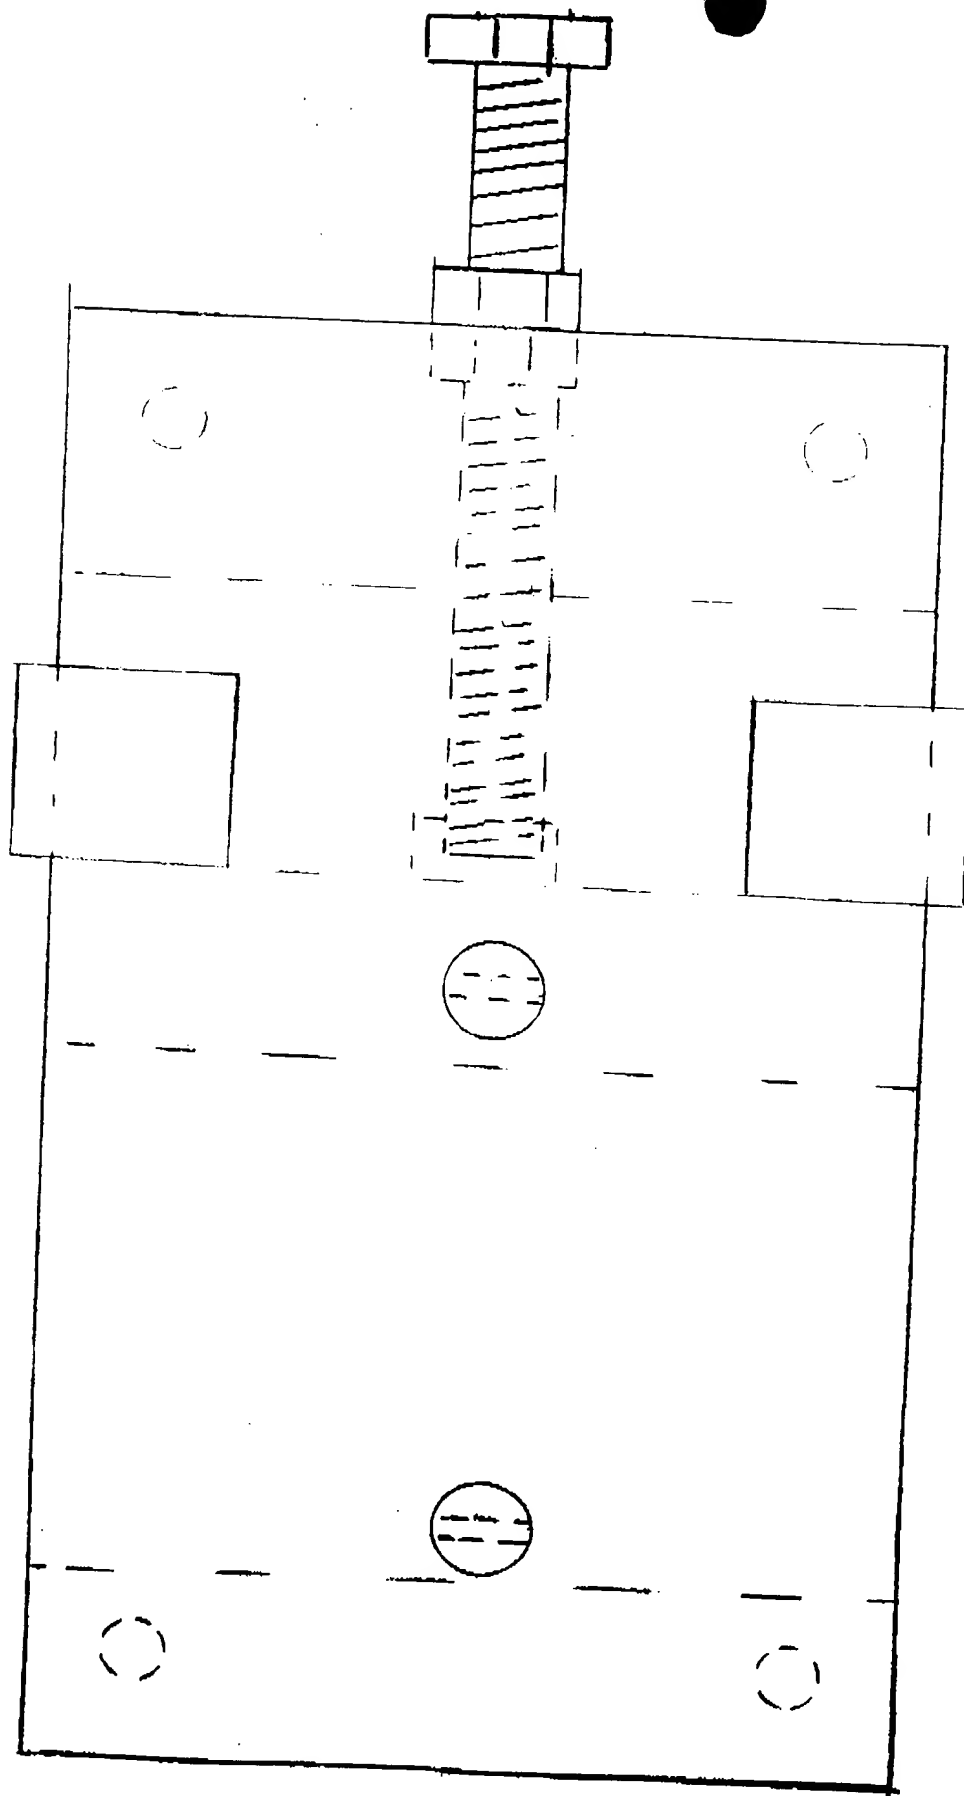


FIGURE 10B